



RUNNING MODE	FAIL MODE	Sol1 (N/O)	Sol2 (N/C)	FS VALVE	B1	B2	CHANGE OF RUNNING MODE	LIMP HOME RUNNING MODE
	NOMARL CONDITION	0	×	×	×	×		
NEUTRAL	Sol1 DISCONNECTED	× ↑	×	×	O↑×	×	H↑N	N MODE
(N MODE)	Sol2 DISCONNECTED	0	×	×	×	×	STAY AT N	N MODE
	ALL Sols DISCONNECTED	× O	×	×	O ↑ ×	×	.H N	N MODE
	NOMARL CONDITION	0	0	×	×	0		
Lo MODE	Sol1 DISCONNECTED	× O	0	O↑×	O [↑] ×	× ↑ O	Lo→Hi	Hi MODE
	Sol2 DISCONNECTED	0	0→×	×	×	× O	N←o→N	Hi MODE
	ALL Sols DISCONNECTED	× 0	× O	×	O ↑ ×	× O	Lo→Hi	Hi MODE
	NOMARL CONDITION	×	×	×	0	×		
Hi MODE	Sol1 DISCONNECTED	×	×	×	0	×	STAY AT Hi	Hi MODE
	Sol2 DISCONNECTED	×	×	×	0	×	STAY AT Hi	Hi MODE
	ALL Sols DISCONNECTED	×	×	×	0	×	STAY AT Hi	Hi MODE

RUNNING MODE	FAIL MODE	Sol1 (N/0)	Sol2 (N/C)	FS VALVE	18	B2	CHANGE OF RUNNING MODE	LIMP HOME RUNNING MODE
Lo MODE	NOMARL CONDITION	0	0	×	×	0		
	Sol1 DISCONNECTED	× O	0	× STICK × →O	O ↑ ×	0	Lo→TIE UP→Hi	Hi MODE

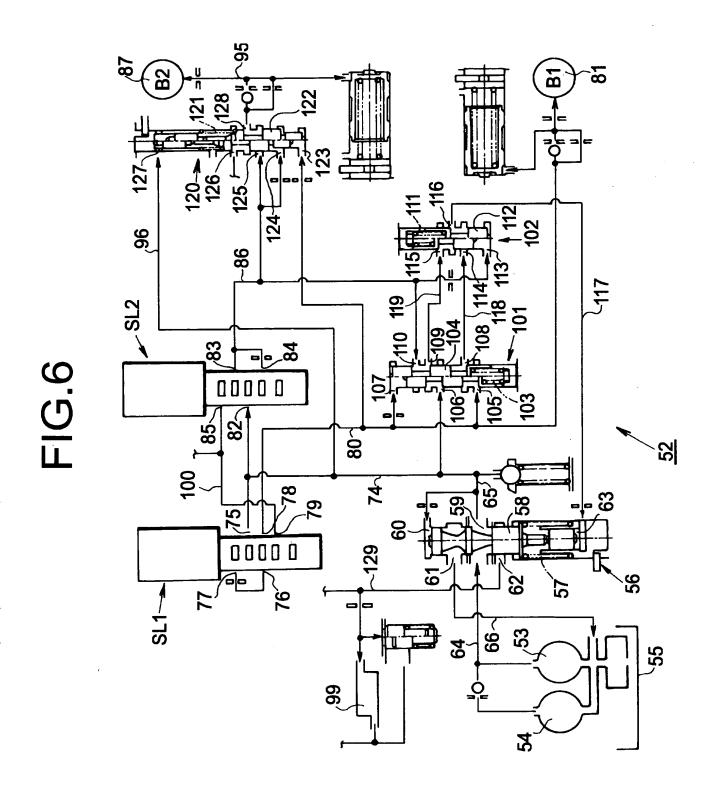

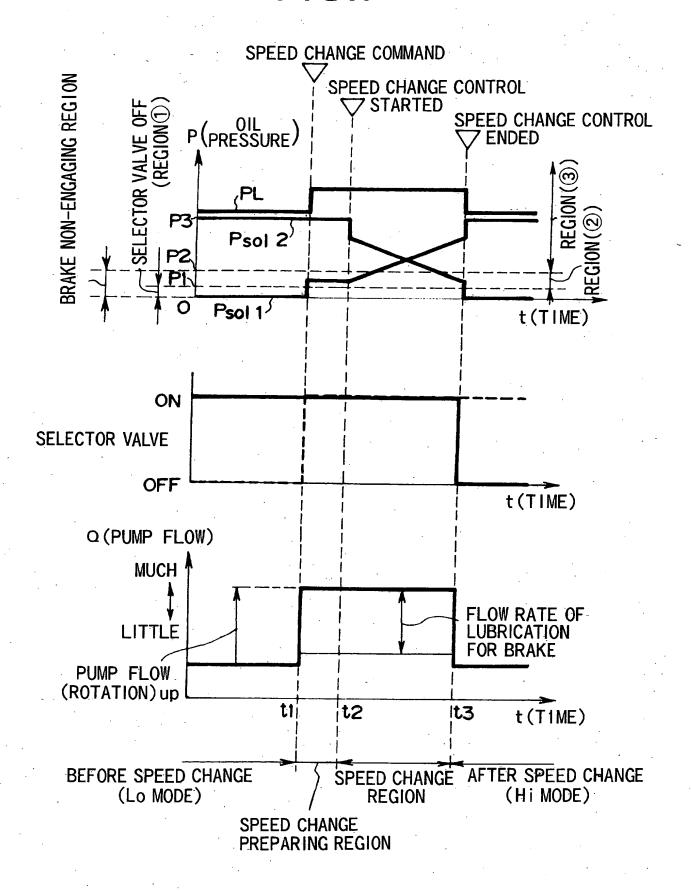

OBLON, SPIVAK, ET AL DOCKET #: 249084US3 INV: Akira MURAKAMI, et al. SHEET 8 OF 11

SPEED CHANGE MODE	Psol1	Psol2
NEUTRAL MODE (1)	REGION(1)	REGION2
NEUTRAL MODE (2)	REGION2	REGION 1
Lo MODE	REGION(1)	REGION3
Hi MODE	REGION3	REGION①
Lo→Hi SPEED CHANGE PREPARING	REGION2	REGION3
Hi→Lo SPEED CHANGE PREPARING	REGION3	REGION ²
SPEED CHANGING	REGION3	REGION3
NEUTRAL MODE (3)	REGION①	REGION①



